


Scale drawing

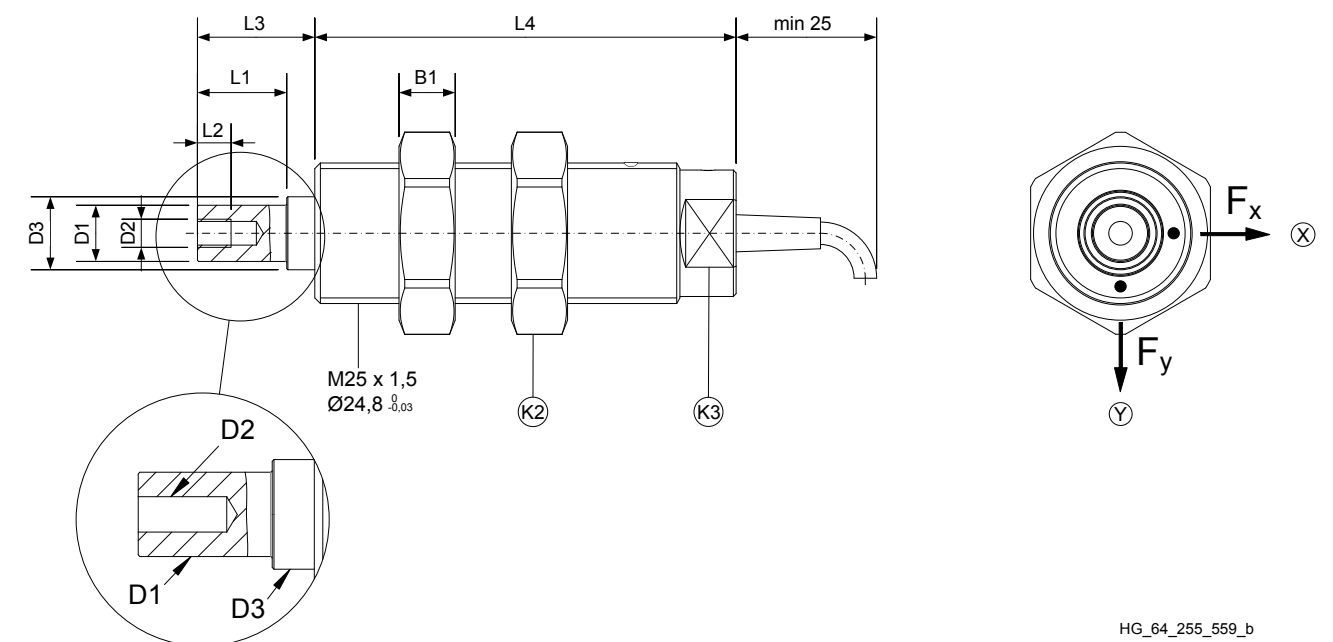

All dimensions in mm
X: blue mark indicates the position of the measuring axis X
Y: red mark indicates the position of the measuring axis Y

Rated measuring ranges

Nominal force [N]							Bearing journal Ø [mm]		
		5*	10	20	30	40	5	8	10
50	60	100	200	300	400**			8	10
500**	600**	1000**							10

The measuring range of the sensor begins at the force's zero point.
Nominal forces differing from the list are available.
* Special type LR (Low Range)
** Special type HR (High Range)

Dimensions

Bearing journal Ø									
D1	-0,006 -0,01	L1	+0,02 0	D2	L2	D3	L3	K2	K3
5		9,9		M3	6	7	12,9	WAF 32	WAF 19
8		11,9		M4	6	10	15,9	WAF 32	WAF 19
10		15,9		M5	8	11	20,9	WAF 32	WAF 19

All dimensions in mm
WAF: width across flats
Non-standard dimensions and execution upon request

Technical data

Rated measuring ranges (F_N)	N	0 to 5...0 to 1000
Rated output	mV/V	1,0...1,5
Rated output tolerance	%	< $\pm 0,2$
Accuracy class		0,25
Excitation voltage max.	V	12
Reference excitation voltage	V	10
Input resistance	Ω	350 ± 3
Output resistance	Ω	350 ± 1
Isolation resistance	GΩ	> 10
Rated temperature range	°C	-10 to 50, Option: -10 to 70
Operational temperature range		
- sensor	°C	-10 to 70
- connection cable	°C	-30 to 80
Storage temperature range	°C	-30 to 70
Reference temperature	°C	23
Temperature influence per 10°C		
- on the zero point	% F_N	< $\pm 0,1$
- on the calibration	% F_N	< $\pm 0,15$
Creep after 30 minutes	% F_N	< $\pm 0,05$
Linear output signal up to	% F_N	approx. 125
Mech. overload protection takes effect at	% F_N	approx. 140
Overload protected ^(#1)	% F_N	400...800 (depending on nominal force)
Deflection at nominal force	mm	$0,07 \pm 20\%$
Resonant frequency of the measuring cell	kHz	> 0,5 (depending on nominal force)
Weight	g	approx. 400
Protection class		IP 50
Sensor housing and nuts		stainless steel
Connection cable		3m long, flexible, shielded 8 x 0,14mm ² , total $\varnothing$ 5,5mm

(#1) radial incoming force without additional bending or tilting moment

Connections

Measuring axis X			Measuring axis Y		
red	+ U_{Br}	Excitation X	yellow	+ U_{Br}	Excitation Y
blue	- U_{Br}		brown	- U_{Br}	
pink	+ U_{Sig}	Output X	white	+ U_{Sig}	Output Y
grey	- U_{Sig}		green	- U_{Sig}	

Shield is not connected to sensor housing.

Order code

RFS 150 XY				- 400	- 10	- 3
Sensor type						
Nominal force [N]						
Bearing journal Ø [mm]						
Cable length [m]	Standard: 3			Option: required length		

Scope of supply

Sensor with protection cap

Options

- connection cable with male plug
- length of connection cable differing from standard
- seal gas protection
- special connection cable, e.g. oil-resistant or for use in Ex-protection areas

Special designs

- nominal forces differing from standard
- customized dimensions (housing / bearing journal)
- with turned-off threaded housing, to realize a gap ring at the bearing position
- advanced temperature range
- for measurement in vacuum

Accessories

- adapters for bearing journals
- for Ex-protection, e.g. Zener-barrier

Technical design subject to change without prior notice. © 2015 by Honigmann

Honigmann Industrielle Elektronik GmbH • Krebsstraße 2-8 • D-42289 Wuppertal • ☎ +49-202-870972-0 • 📠 +49-202-870972-99